



N.C. Department of Labor
Division of Occupational Safety and Health
1101 Mail Service Center
Raleigh, North Carolina 27699-1101

Cherie K. Berry
Commissioner of Labor

HAZARD ALERT

Multi-Piece Rims

Lethal Hazards Part of Rim Repair Work

Accident Summary

Site: Accident took place at a truck dealership that bought, sold and traded medium- to heavy-duty commercial trucks. The dealership also serviced commercial trucks and buses but did not work on multi-piece rim wheels.

Accident Findings: A body shop technician was fatally injured by the split side ring of a multi-piece tire rim that suddenly released. The victim had been rotating the two front tires on a 1995 bus brought in for front end alignment. Both wheels were mounted on a five-spoke hub. The front right wheel had been removed and set aside, and the employee was taking off the front left wheel. Four of the five rim clamps, studs and nuts had been removed when the side ring flew off, striking the employee in the head and chest. The victim was taken to the hospital, where he was pronounced dead.



Typical six spoke wheel on a bus.



Close-up of lug nut holding rim to wheel.

The parts are designed to allow the split ring to fit snugly into the gutter on the rim and hold the tire on the wheel when the tire is inflated.


The split side ring markings were illegible because the ring had been painted over with black paint four months earlier. When the paint was scraped off, the split side ring markings showed the ring was mismatched with the rim base and had been damaged when it was mounted previously or had been bent during the accident.



Inner wheel with tire mounted. Inset: Close-up of split rim against mounted tire.

A multi-piece wheel has two or more parts. The side ring holds the tire and other components on the rim wheel by interlocking the components when the tire is inflated.

There are several variations of a multi-piece rim, including two-piece and three-piece assemblies. The rim pictured below is a tube-type demountable rim assembly with a split side ring typical of two-piece assemblies.

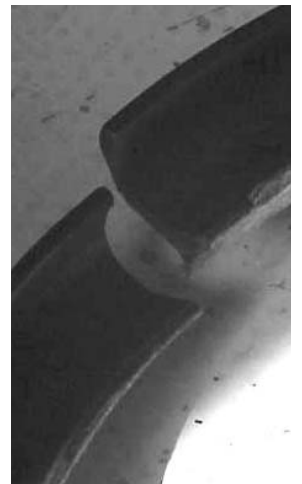

Close-up of rim at split.

The victim had been disassembling the wheel thinking that it had been put together according to the manufacturer's specifications. The employee had no reason to believe the mismatched split side ring and the rim base were not properly seated. The tire was properly inflated and had been driven for about four months before the incident.

Conclusion:

Mismatched multi-piece wheel components led to the catastrophic accident. OSHA standards clearly state that multi-piece components should not be interchanged except according to appropriate charts and the applicable rim manual. Other findings include:

- The split side ring was not completely seated and locked.
- Rim gutters and ring must be free of any surface rust that could obstruct seating of the ring.

Recommendations:

When working with multi-piece and single-piece rimmed wheels, **always** use a cage or barrier to protect the worker. There is no greater safety measure than a protective barrier for employees.

If the rim is painted or the markings otherwise illegible, the wheel and tire assembly should not be serviced.

Employees should be reminded regularly of the dangers of working around single-piece and multi-piece rim wheels. Employees must be extremely cautious when mounting and demounting rim wheels. Safety precautions should extend to other activities such as inflating, deflating, installation, removal and handling. In this particular accident, the employee had no plans of doing anything more than rotating the tires.

continued on page 2

The OSHA standard (1910.177) for servicing single-piece and multi-piece rim wheels has four major requirements: (1) training for all tire servicing employees; (2) the use of industry-accepted procedures that minimize the potential for employee injury; (3) the use of proper equipment such as clip-on chucks, restraining devices or barriers to retain the wheel components in the event of an incident during the inflation of tires; and (4) the use of compatible components.

Pressurized Parts Pose Deadly Dangers

For employees working on either single-piece or multi-piece rim wheels, the dangers of a sudden release can be deadly. Employees working on a single-piece rim can be thrown across a shop by the sudden air release or can be fatally injured by a thrown rim.

Multi-piece rims are even more dangerous because of the various pieces flying off during a violent release. With multi-piece rims, employees also must take care to ensure that parts have not been mismatched mistakenly.

Multi-piece wheel components and single-piece wheels must be inspected before assembly. Any wheel or wheel component that is bent out of shape, pitted from corrosion, broken, or cracked must be marked or tagged “unserviceable” and removed from the service area. Damaged or leaky valves must be replaced.

Printed 3/07. 500 copies of this public document were printed at a cost of \$96, or \$.16 per copy.



HAZARD ALERT

N.C. Department of Labor
Education, Training and Technical Assistance Bureau
1101 Mail Service Center
Raleigh, North Carolina 27699-1101